


User manual

ALFA 13 DP Pt1000 and ALFANET 13 DP Pt1000

Min./Max. Alarm Thermostat.

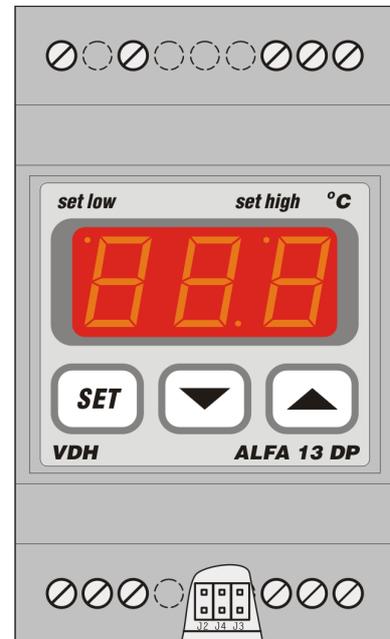

VDH doc. 100293

Version: v1.0

Date: 25-03-2010

Software: 100294_ALFA 13/33DP Pt1000

File: Do100293.wpd

Range: -10/+90°C per 0,1°C

* Function.

The **ALFA(NET) 13 DP Pt1000** is a digital alarm thermostat for rail mounting. The thermostat watches the minimum and maximum temperature. The temperature readout is in tenth of degrees Celsius. The **ALFA(NET) 13 DP Pt1000** has one relay for both alarms. The **ALFANET 13 DP** has a RS 485 network connection so it can be read out and adjusted on the Alfanet.

* Installation.

On the connection diagram of the **ALFA(NET) 13 DP Pt1000** is shown how the sensor, power supply and relay are connected.

After connecting the **ALFA(NET) 13 DP Pt1000** to the power supply, a self-test function is started. As this test is finished, the measured temperature appears in the display.

The relay is normally activated, and with an alarm it is deactivated, and the led 'set high' will be lit in the display.

* Control.

The **ALFA 13 DP Pt1000** alarm-thermostat can be controlled by three push buttons on the front;

SET - view / change set points and reset of alarm.

UP - increase a set point.

DOWN - decrease a set point.

* Viewing set points.

Viewing set point of maximum alarm:

By pushing the **SET** key first and then the **UP** key together the maximum alarm set point appears in the display. The led 'set high' starts blinking.

Viewing set point of minimum alarm:

By pushing the **SET** key first and then the **DOWN** key together the maximum alarm set point appears in the display. The led 'set low' starts blinking.

A few seconds after releasing the keys the set point disappears and the measured temperature is shown in the display.



* **Changing set points.**

Push the **SET** key together with the **UP** or **DOWN** key and the maximum alarm set point or minimum alarm set point appears in the display. Release both keys.

Now push and hold the **SET** key again and together with the **UP** or **DOWN** keys the set point can be changed. A few seconds after releasing the keys the measured temperature is shown again in the display.

* **Action of the alarm functions.**

The **ALFA(NET) 13 DP Pt1000** alarm thermostat has a minimum alarm and a maximum alarm, both with their own set point. We can choose off two different kind of alarms (Parameter 27) namely:

a watchdog alarm (relay normally activated, at alarm, it falls off and the led 'set high' burns. On power failure the alarm relay also falls off.)

or a regulated alarm (relay normally not activated, at alarm, it will be activated and the led 'set high' burns.

With Parameter 28 we can choose for a auto reset alarm or a hold alarm after temperature recovering. Also it is possible to give both set points their own offset and differential, see function diagram.

Each alarm can be set at an alarm-delay time (Parameter 23 and 24), when the temperature passes the set alarm point, the led 'set high' first starts to blink. If the temperature will recover within the delay time, no alarm occurs. If an alarm will continue after the delay time, the led 'set high' burns continuously, and the display alternates between the temperature and 'H' for high-alarm (max.) or 'L' for low-alarm (min.) to indicate the alarm.

To reset an alarm press the **SET** key.

* **Adjustment sensor.**

The sensor can be adjusted by using the Sensor Offset (parameter 04). Indicates the **ALFA(NET) 13 DP Pt1000** e.g. 2°C to much, the Sensor Offset has to be decreased with 2°C.

* **Error messages.**

In the display of the **ALFA(NET) 13 DP Pt1000** the following error messages can appear:

Er - Sensor broken. Solution:
- Check if the sensor is connected correctly.
- Check the sensor (1000Ω at 0°C).
- Replace the sensor.

EE - Settings are lost. Solution:
- Reprogram the settings.

* **Technical details.**

Model : ALFA 13 DP Pt1000 Alarm Thermostat
: ALFANET 13 DP Pt1000 Alarm Thermostat with Network
Range : -10/+90°C, readout per 0,1°C
Supply : 230 Vac / 1,2VA 50/60Hz (or else see product sticker)
Relay : SPDT 250V/16A(C-NO), 8A(C-NC) (cos phi=1)
Communication : RS 485 Network (2xtwisted pair shielded) only at ALFANET model.
Control : by pushbuttons on the front.
Front : Polycarbonate IP65
Sensor : Pt1000 3-wire (100Ω at 0°C)
Sizes : 90 x 53 x 58mm (hwd)
Panel hole : 46 x 53mm (hw)

- Provided with memory protection during power failure.
- Connection with screw terminals on the backside.
- Equipped with self test function and sensor failure detection.
- Special version on request available.



* **Setting internal parameters.**

Next to the adjustment of the set point, some other internal settings are possible, like differential, sensor-offset, set point range.


By pushing the **DOWN** key more than 10 seconds, you enter the 'internal programming menu'. In the left display the upper and lower segment are blinking. With the **UP** and **DOWN** keys the required parameter can be selected (see table for the parameters). If the required parameter is selected, the value can be read-out by pushing the **SET** key. Pushing the **UP** and **DOWN** keys allows you to change the value of this parameter.

If after 20 seconds no key is pushed, the **ALFA(NET) 13 DP** changes to it's normal operation mode.


* **Parameters ALFA(NET) 13 DP Pt1000.**

Parameter	Description Parameter	Range	Standard Value
04	Offset temperature sensor	-15.0..+15.0°C	0.0
10	Startup delay after power failure	0..99 Minutes	0
11	Relay on at sensor failure	0 = No, 1 = Yes	0
21	Differential maximum alarm	0.1..15.0°C	1.0
22	Differential minimum alarm	0.1..15.0°C	1.0
23	Time delay maximum alarm	0..99 Minutes	0
24	Time delay minimum alarm	0..99 Minutes	0
25	Offset setpoint High (Max.)	-10.0..+10.0°C	0.0
26	Offset setpoint Low (Min.)	-10.0..+10.0°C	0.0
27	Relay alarm function (0=watchdog 1=regulated alarm)	0..1	0
28	Auto reset alarm after temperature recovering (0=hold)	0 = No, 1 = Yes	0
90	Network number	1..250	1
95	Software version	0..255	-
96	Production year	00..99	-
97	Production week	1..52	-
98	Serial number (x1000)	0..255	-
99	Serial number (units)	0..999	-


* **Function diagram.**

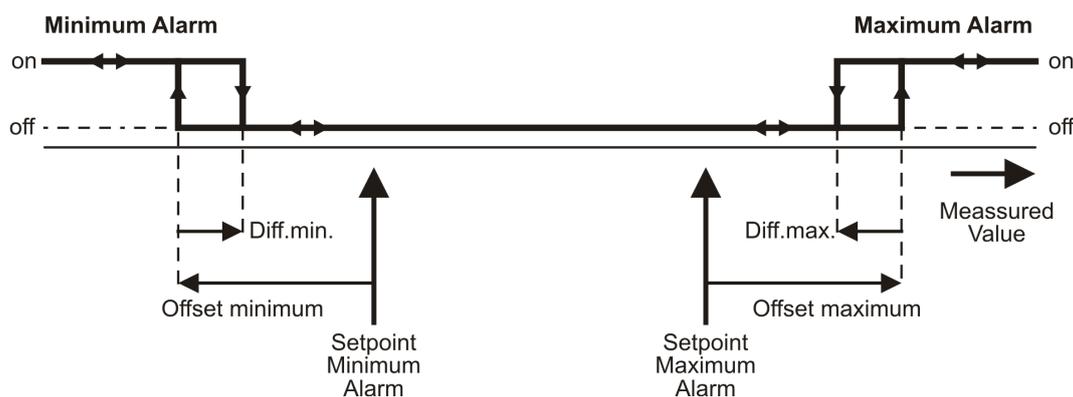

* **Dimensions.**

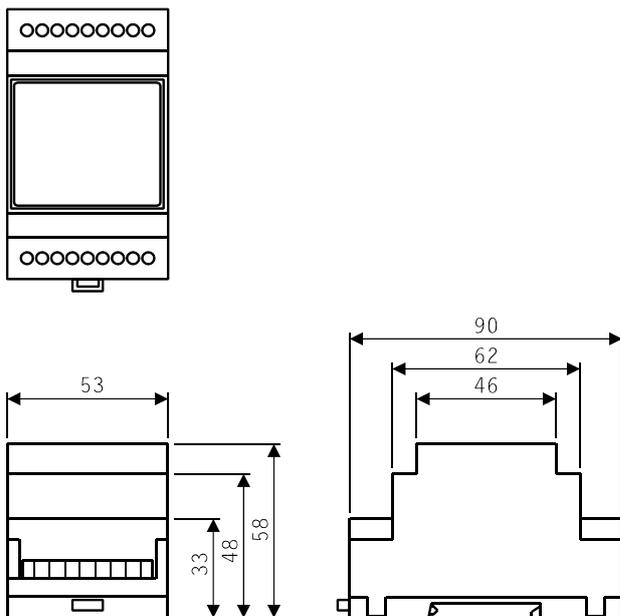

* **Connections.**

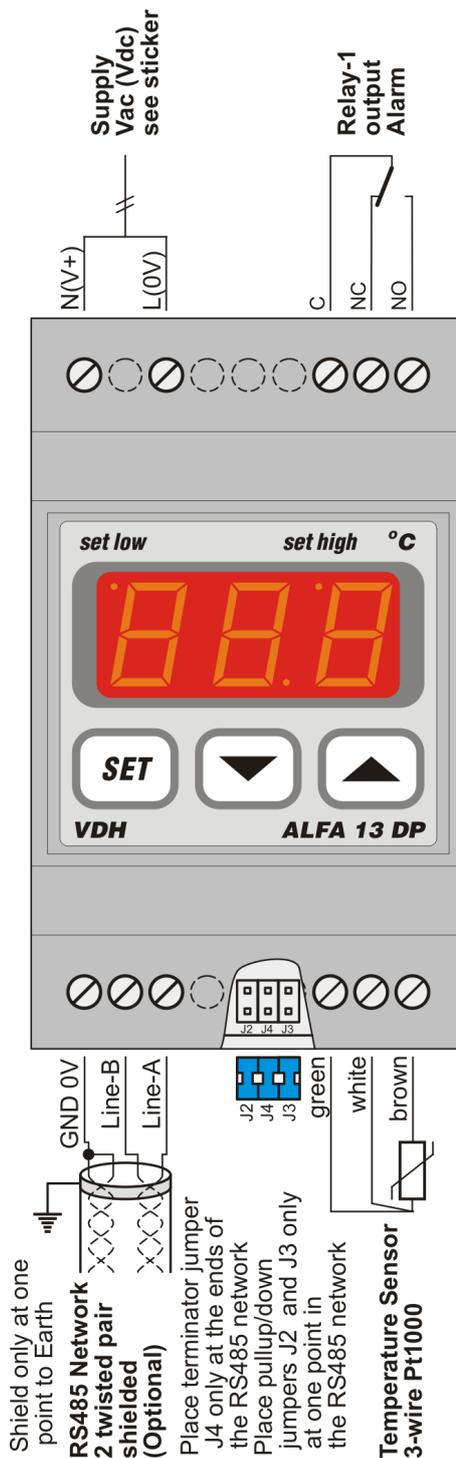

* **Address.**

VDH Products BV
 Produktieweg 1
 9301 ZR Roden
 The Netherlands

Tel: +31 (0)50 - 30 28 900
 Fax: +31 (0)50 - 30 28 980
 Email: info@vdhproducts.nl
 Internet: www.vdhproducts.nl

